


# Quality Assurance Site Survey Report for Ontario-Route 60 Near Road

*Last updated May, 2016*



AQS ID	ARB Number	Site Start Date	Reporting Agency and Agency Code
060710027	36036	1/1/2015	South Coast AQMD (061)

Site Address	County	Air Basin	Latitude	Longitude	Elevation
2330 S. Castle Harbour	San Bernardino	South Coast	34° 01' 51" N	117° 37' 02" N	258m

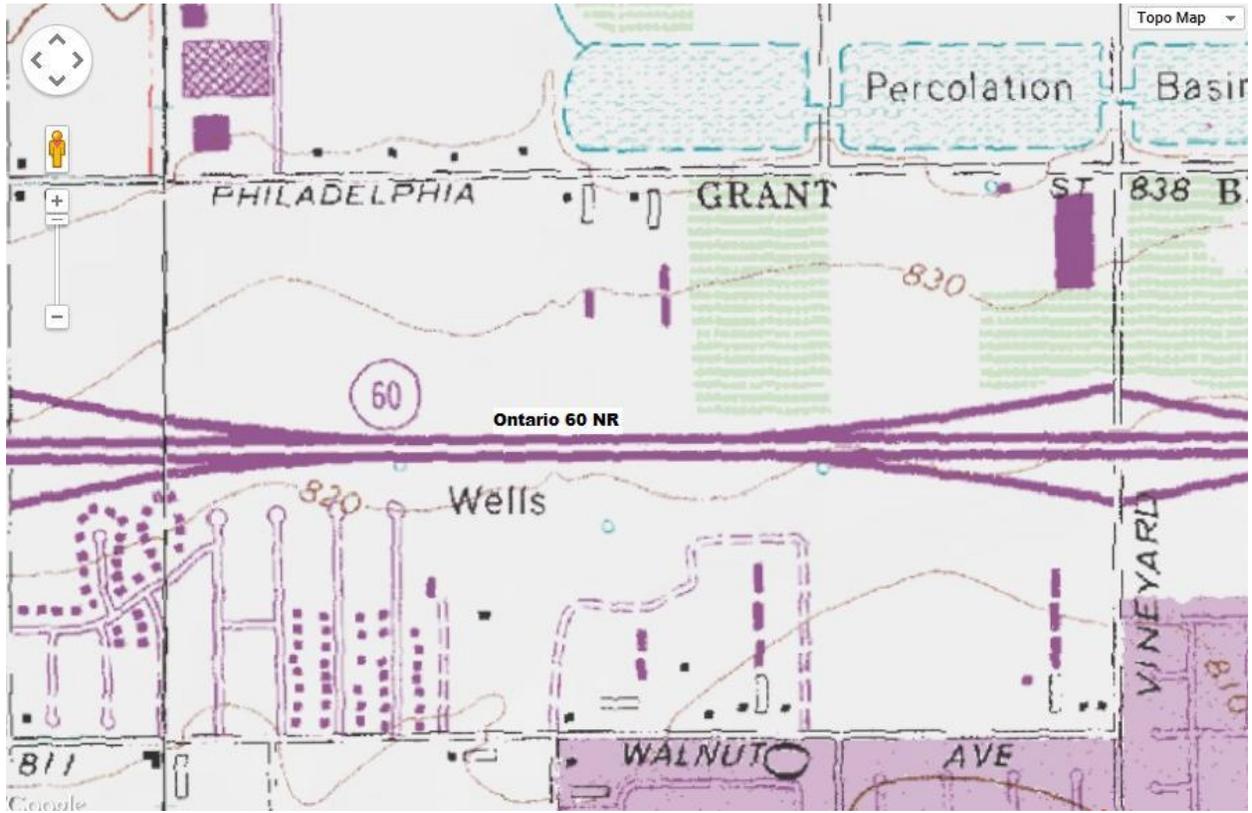

## Detailed Site Information

Local site name	Ontario-Route 60 Near Road			
AQS ID	060710027			
GPS coordinates (decimal degrees)	Latitude: 34° 01' 51" N Longitude: 117° 37' 02" N			
Street Address	2330 S. Castle Harbour Ontario, CA 91761			
County	San Bernardino			
Distance to roadways (meters)	10 m			
Traffic count (AADT, year)	215,000 / 2012			
Groundcover (e.g. asphalt, dirt, sand)	Gravel/Grass			
Representative statistical area name (i.e. MSA, CBSA, other)	40140-Riverside-San Bernardino-Ontario, CA MSA			
Pollutant, POC	Nitrogen Dioxide, 1	24 Hour PM2.5, 1	Continuous PM2.5, 3	
Parameter code	42602	See Table 26	88101	
Basic monitoring objective(s)	NAAQS	NAAQS	NAAQS	
Site type(s)	Population Exposure	Population Exposure	Population Exposure	
Monitor (type)	SLAMS	SLAMS	SLAMS	
Instrument manufacturer and model	Thermo 42i	Thermo 2025i	Thermo 5014	
Method code	074	118,145	183	
FRM/FEM/ARM/ other	FRM	FRM	FEM	
Collecting Agency	SCAQMD	SCAQMD	SCAQMD	
Analytical Lab (i.e. weigh lab, toxics lab, other)	N/A	SCAQMD	N/A	
Reporting Agency	SCAQMD	SCAQMD	SCAQMD	
Spatial scale (e.g. micro, neighborhood)	Micro	Micro	Micro	
Monitoring start date (MM/DD/YYYY)	01/2015	1/2015	1/2015	
Current sampling frequency (e.g. 1:3, continuous)	1:1	1:1	1:1	
Calculated sampling frequency (e.g. 1:3/1:1)	N/A	1:1	1:1	
Sampling season (MM/DD-MM/DD)	01/01-12/31	01/01-12/31	01/01-12/31	
Probe height (meters)	4.5	4.5	4.5	
Distance from supporting structure (meters)	2.0	2.0	2.0	
Distance from obstructions on roof (meters)	N/A	N/A	N/A	
Distance from obstructions not on roof (meters)	N/A	N/A	N/A	

Distance from trees (meters)	N/A	N/A	N/A	
Distance to furnace or incinerator flue (meters)	N/A	N/A	N/A	
Distance between collocated monitors (meters)	N/A	N/A	N/A	
Unrestricted airflow (degrees)	360°	360°	360°	
Probe material for reactive gases (e.g. Pyrex, stainless steel, Teflon)	Teflon	NA	NA	
Residence time for reactive gases (seconds)	6.8	NA	NA	
Will there be changes within the next 18 months? (Y/N)	No	No	No	
Is it suitable for comparison against the annual PM2.5? (Y/N)	N/A	Yes	Yes	
Frequency of flow rate verification for manual PM samplers	N/A	Monthly	N/A	
Frequency of flow rate verification for automated PM analyzers	N/A	N/A	Monthly	
Frequency of one-point QC check for gaseous instruments	Nightly	N/A	N/A	
Last Annual Performance Evaluation for gaseous parameters (MM/DD/YYYY)	10/01/2015	N/A	N/A	
Last two semi-annual flow rate audits for PM monitors (MM/DD/YYYY, MM/DD/YYYY)	N/A	Unaudited first half, 11/19/2015	Unaudited	

**Ontario-Route 60 Near Road  
Site Photos**



**Looking North from the probe.**



**Looking East from the probe.**



**Looking South from the probe.**



**Looking West from the probe.**

**Ontario-Route 60 Near Road  
Site Photos (Cont.)**



**Looking at the probe from the North.**



**Looking at the probe from the East.**



**Looking at the probe from the South.**



**Looking at the probe from the West.**